






Indicatori di liquido e indicatori d'umidità
Liquid and moisture indicators
Voyant liquide et indicateurs d'humidité
Flüssigkeitsschauglas und flüssigkeitsindikatoren

Disegno Drawing Dessin Zeichnung	N° catalogo Part number N° catalogue Katalog Nr.	Attacchi Connections Raccords Anschlüsse							PS [bar]	TS [°C]		Confezione n° pz Package pcs Emballage Verpackung
		ODS		ODM		Per tubo For pipe Pour tuyau Für rohr				min	max	
		Ø [in.]	Ø [mm]	Ø [in.]	Ø [mm]	Ø [in.]	Ø [mm]	Foro Hole Orifice Loch Ø [mm]				

Attacchi di rame a saldare / copper braze connections / raccords a souder en cuivre / kupfer lötlanschlüsse

	3940/X01	-	-	-	6	-	-	-	45	-40	+120	120
	3940/X02	-	-	-	6	-	-	-	45	-40	+120	48
	3770/M28	-	-	-	28	-	-	-	45	-30	+110	21
	3770/11			1.3/8"	35							17
	3770/13			1.5/8"	-							17
	3770/M42			-	42							17
	3771/11	1.3/8"	35	-	-	-	-	-	45	-30	+110	17
	3771/M42	-	42	-	-	-	-	-	45	-30	+110	17
	3771/17	2.1/8"	-	-	-	-	-	-	45	-30	+110	15

A sella / saddle type / embase à braser / sattel typ

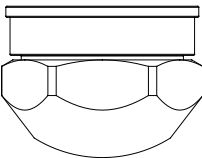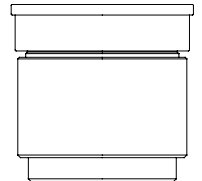	3780/5	-	-	-	-	5/8"	16	-	45	-30	+110	225
	3780/M18					-	18					
	3780/7					7/8"	22					
	3780/9					1.1/8"	28					
	3780/11					1.3/8"	35					
	3781/M28	-	-	-	-	-	-	28	45	-30	+110	210

CLASSIC